

# Dayton and Westward Product Information

Click on the manufacturer and brand of your cable ratchet puller below to see the product details

Dayton – Grainger SKUs

Dayton – Zoro SKUS

Westward – Grainger SKUs

Westward – Zoro SKUS



**\*\*\*\*\*IMPORTANT - PRODUCT SAFETY NOTICE\*\*\*\*\***

**Dayton Cable Ratchet Puller**

**Affected Grainger Part Numbers: 3AY59, 3AY60, 3AY61**

January 25, 2021

Name  
Address  
City, State Zip

Dayton Electric Manufacturing Co., a subsidiary of W.W. Grainger, Inc., has determined that you may have purchased a Dayton (**Grainger SKU 3AY59, 3AY60, 3AY61**) cable ratchet puller, labeled to be in compliance with ASME safety standard B 30.21. To comply with ASME B 30.21, cable ratchet pullers must have a safety factor of 4x the Working Load Limit (WLL) for which the product has been rated for both lifting and pulling operations. In other words, to comply with ASME B 30.21, the product must have 4x the strength capacity that is listed in the product capacity rating, for both lifting and pulling operations.

Dayton has recently learned through testing, however, that the affected SKUs listed above may only have a safety factor of 2x WLL for the product's rated pulling capacity, rather than the 4X WLL required by ASME B 30.21. Although we are not aware of any injuries that have occurred due to the reduced safety factor of the affected products, we place our customers' safety as our utmost priority. We are, therefore, issuing this notice to alert you that the cable ratchet pullers identified in the chart below (along with each product's specified capacity) have a lower safety standard for pulling operations than is required by ASME B 30.21.

**Specifically, if 2x WLL of capacity for the ratchet puller is exceeded in a pulling operation, the ratchet might fail under load and create a serious safety hazard. Your prompt action to this notice is strongly encouraged.**

Based on our sales records, you may have received a cable ratchet puller that is impacted, and it is marked as such with the Lifting/Pulling capacity (please see photo below). **If you have one or more of the items identified in this notice, please immediately remove them from service and discard it pursuant to your facility's procedures.**

Please check any Cable Ratchet Puller you may have in your possession and check for the "lifting/pulling" marking, as shown in the image's below.

For instructions on what to do with your ratchet puller(s) or to obtain replacements, **please visit [www.recallrtr.com/cableratchet](http://www.recallrtr.com/cableratchet) or call toll free at 877-206-1172. Also, please use the verification code provided at the bottom of this notice when you register your ratchet puller(s) online or call the support center.**

In the event that you resold this product, we ask that you contact your customer and provide them with this Product Safety Notice.





We thank you for your patience and assistance on this matter.

**VERIFICATION CODE: XXXXXXXX**



Dayton Electric Manufacturing Co.

100 Grainger

Grainger SKU	Brand	Photo	Specified Capacity
3AY59	Dayton	 A manual ratchet puller with a red handle and a silver metal body. It features a hook at the top and a hook at the bottom. A label on the handle reads: "Dayton Manual Ratchet Puller 3AY59A Capacity 1000 Lbs. 1100-1012".	Single/Double 1000/2000 lb.
3AY60	Dayton	 A manual ratchet puller with a red handle and a silver metal body. It features a hook at the top and a hook at the bottom.	Single/Double 1000/2000 lb.
3AY61	Dayton	  A manual ratchet puller with a red handle and a silver metal body. It features a hook at the top and a hook at the bottom. A close-up of the label on the handle reads: "Dayton Manual Ratchet Puller 3AY61 Capacity 1700 Lbs. 1100-1013".	Single/Double 1700/3400 lb.



**\*\*\*\*\*IMPORTANT - PRODUCT SAFETY NOTICE\*\*\*\*\***

**Dayton Cable Ratchet Puller**

**Affected Zoro Part Numbers: G2639901, G2297915, G0691144**

January 25, 2021

Name  
Address  
City, State Zip

Dayton Electric Manufacturing Co., a subsidiary of W.W. Grainger, Inc., has determined that you may have purchased a Dayton (**Zoro SKU G2639901, G2297915, G0691144**) cable ratchet puller, labeled to be in compliance with ASME safety standard B 30.21. To comply with ASME B 30.21, cable ratchet pullers must have a safety factor of 4x the Working Load Limit (WLL) for which the product has been rated for both lifting and pulling operations. In other words, to comply with ASME B 30.21, the product must have 4x the strength capacity that is listed in the product capacity rating, for both lifting and pulling operations.

Dayton has recently learned through testing, however, that the affected SKUs listed above may only have a safety factor of 2x WLL for the product's rated pulling capacity, rather than the 4X WLL required by ASME B 30.21. Although we are not aware of any injuries that have occurred due to the reduced safety factor of the affected products, we place our customers' safety as our utmost priority. We are, therefore, issuing this notice to alert you that the cable ratchet pullers identified in the chart below (along with each product's specified capacity) have a lower safety standard for pulling operations than is required by ASME B 30.21.

**Specifically, if 2x WLL of capacity for the ratchet puller is exceeded in a pulling operation, the ratchet might fail under load and create a serious safety hazard. Your prompt action to this notice is strongly encouraged.**

Based on our sales records, you may have received a cable ratchet puller that is impacted, and it is marked as such with the Lifting/Pulling capacity (please see photo below). **If you have one or more of the items identified in this notice, please immediately remove them from service and discard it pursuant to your facility's procedures.**

Please check any Cable Ratchet Puller you may have in your possession and check for the "lifting/pulling" marking, as shown in the image's below.

For instructions on what to do with your ratchet puller(s) or to obtain replacements, **please visit [www.recallrtr.com/cableratchet](http://www.recallrtr.com/cableratchet) or call toll free at 877-206-1172. Also, please use the verification code provided at the bottom of this notice when you register your ratchet puller(s) online or call the support center.**

In the event that you resold this product, we ask that you contact your customer and provide them with this Product Safety Notice.

We thank you for your patience and assistance on this matter.



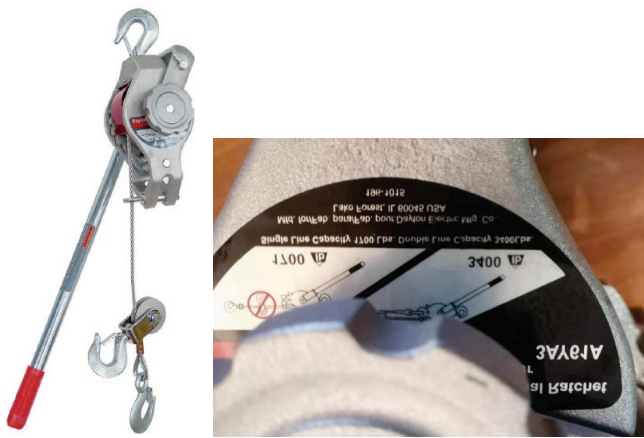
**VERIFICATION**

**XXXXXXXXXX**



Dayton Electric Manufacturing Co.

100 Grainger

Zoro SKU	Brand	Photo	Specified Capacity
G2639901	Dayton		Single/Double 1000/2000 lb.
G2297915	Dayton		Single/Double 1000/2000 lb.
G0691144	Dayton		Single/Double 1700/3400 lb.



**\*\*\*\*\*IMPORTANT - PRODUCT SAFETY NOTICE\*\*\*\*\***

**Westward Cable Ratchet Puller**

**Affected Grainger Part Numbers: 4LY45, 4LY46, 4LY47**

January 25, 2021

Name  
Address  
City, State Zip

W.W. Grainger, Inc. has determined that you may have purchased a Westward (**Grainger SKU 4LY45, 4LY46, 4LY47**) cable ratchet puller, labeled to be in compliance with ASME safety standard B 30.21. To comply with ASME B 30.21, cable ratchet pullers must have a safety factor of 4x the Working Load Limit (WLL) for which the product has been rated for both lifting and pulling operations. In other words, to comply with ASME B 30.21, the product must have 4x the strength capacity that is listed in the product capacity rating, for both lifting and pulling operations.

We have recently learned through testing, however, that the affected SKUs listed above may only have a safety factor of 2x WLL for the product's rated pulling capacity, rather than the 4X WLL required by ASME B 30.21. Although we are not aware of any injuries that have occurred due to the reduced safety factor of the affected products, we place our customers' safety as our utmost priority. We are, therefore, issuing this notice to alert you that the cable ratchet pullers identified in the chart below (along with each product's specified capacity) have a lower safety standard for pulling operations than is required by ASME B 30.21.

**Specifically, if 2x WLL of capacity for the ratchet puller is exceeded in a pulling operation, the ratchet puller might fail under load and create a serious safety hazard. Your prompt action to this notice is strongly encouraged.**

Based on our sales records, you may have received a cable ratchet puller that is impacted, and it is marked as such with the Lifting/Pulling capacity (please see photo below). **If you have one or more of the items identified in this notice, please immediately remove them from service and discard it pursuant to your facility's procedures.**

Please check any Cable Ratchet Puller you may have in your possession and check for the "lifting/pulling" marking, as shown in the image's below.

For instructions on what to do with your ratchet puller(s) or to obtain replacements, **please visit [www.recallrtr.com/cableratchet](http://www.recallrtr.com/cableratchet) or call toll free at 877-206-1172. Also, please use the verification code provided at the bottom of this notice when you register your ratchet puller online or call the support center.**

In the event that you resold this product, we ask that you contact your customer and provide them with this Product Safety Notice.

On behalf of Grainger, we thank you for your patience and assistance on this matter.

**VERIFICATION**

**XXXXXXXX**

Grainger SKU	Brand	Photo	Specified Capacity
4LY45	Westward	 	Lifting/Pulling 1000/2000 lb.
4LY46	Westward	 	Lifting/Pulling 1500/3000 lb.
4LY47	Westward	  	Lifting/Pulling 1500/3000 lb.



**\*\*\*\*\*IMPORTANT - PRODUCT SAFETY NOTICE\*\*\*\*\***

**Westward Cable Ratchet Puller**

**Affected Zoro Part Numbers: G2386431, G1367624, G2281291**

January 25, 2021

Name  
Address  
City, State Zip

W.W. Grainger, Inc. has determined that you may have purchased a Westward (**Zoro SKU G2386431, G1367624, G2281291**) cable ratchet puller, labeled to be in compliance with ASME safety standard B 30.21. To comply with ASME B 30.21, cable ratchet pullers must have a safety factor of 4x the Working Load Limit (WLL) for which the product has been rated for both lifting and pulling operations. In other words, to comply with ASME B 30.21, the product must have 4x the strength capacity that is listed in the product capacity rating, for both lifting and pulling operations.

We have recently learned through testing, however, that the affected SKUs listed above may only have a safety factor of 2x WLL for the product's rated pulling capacity, rather than the 4X WLL required by ASME B 30.21. Although we are not aware of any injuries that have occurred due to the reduced safety factor of the affected products, we place our customers' safety as our utmost priority. We are, therefore, issuing this notice to alert you that the cable ratchet pullers identified in the chart below (along with each product's specified capacity) have a lower safety standard for pulling operations than is required by ASME B 30.21.

**Specifically, if 2x WLL of capacity for the ratchet puller is exceeded in a pulling operation, the ratchet puller might fail under load and create a serious safety hazard. Your prompt action to this notice is strongly encouraged.**

Based on our sales records, you may have received a cable ratchet puller that is impacted, and it is marked as such with the Lifting/Pulling capacity (please see photo below). **If you have one or more of the items identified in this notice, please immediately remove them from service and discard it pursuant to your facility's procedures.**

Please check any Cable Ratchet Puller you may have in your possession and check for the "lifting/pulling" marking, as shown in the image's below.

For instructions on what to do with your ratchet puller(s) or to obtain replacements, **please visit [www.recalltr.com/cableratchet](http://www.recalltr.com/cableratchet) or call toll free at 877-206-1172. Also, please use the verification code provided at the bottom of this notice when you register your ratchet puller online or call the support center.**

In the event that you resold this product, we ask that you contact your customer and provide them with this Product Safety Notice.

On behalf of Grainger, we thank you for your patience and assistance on this matter.

**VERIFICATION**

**XXXXXXXXXX**



Zoro SKU	Brand	Photo	Specified Capacity
G2386431	Westward	 	Lifting/Pulling 1000/2000 lb.
G1367624	Westward	 	Lifting/Pulling 1500/3000 lb.
G2281291	Westward	  	Lifting/Pulling 1500/3000 lb.